



**Airforce Turbine Service**  
 www.PT6A.aero

11557 Hwy 359 Mathis, TX 78368  
 P.O. Box 146 Tynan, TX 78391  
 Ph: (361) 547-3386 Fx: (361) 547-7273

ATS Form# 1024

<b>Engine Rotor Sheet</b>							
PT6A:	<b>-65B</b>	TSN:	<b>24,765.4</b>	TSO:	<b>1,457.4</b>	W/O#:	<b>6083</b>
PCE:	<b>32424</b>	CSN:	<b>24,229</b>	CSO:	<b>1,426</b>	TSHS:	<b>0.0</b>

<b>Life Limited Part (LLP) Listing</b>				
	P/N	S/N	Cycles	
			Consumed	Remaining
<b>Rotor, Compressor</b>	<b>3037101</b>	<b>20A132</b>	<b>16,486</b>	<b>7,514</b>
<b>Shaft, Comp. Rotor</b>	<b>3039799</b>	<b>89A324</b>	<b>8,881</b>	<b>15,119</b>
<b>2<sup>nd</sup> Stg. Disk</b>	<b>3036802</b>	<b>36A295</b>	<b>16,486</b>	<b>7,514</b>
<b>3<sup>rd</sup> Stg. Disk</b>	<b>3036803</b>	<b>32A114</b>	<b>16,486</b>	<b>7,514</b>
<b>4<sup>th</sup> Stg. Disk</b>	<b>3036804</b>	<b>21A047</b>	<b>16,486</b>	<b>7,514</b>
<b>4<sup>th</sup> Stg. Spacer</b>	<b>3114590-01</b>	<b>47A831</b>	<b>9,067</b>	<b>14,933</b>
<b>Impeller</b>	<b>3037204</b>	<b>6E142</b>	<b>4,022</b>	<b>19,978</b>
<b>CT Disk</b>	<b>3036711</b>	<b>3W122</b>	<b>5,745</b>	<b>9,255</b>
<b>1<sup>st</sup> Stg. PT Disk</b>	<b>3029312</b>	<b>2C387</b>	<b>18,510</b>	<b>11,490</b>
<b>2<sup>nd</sup> Stg. PT Disk</b>	<b>3029313</b>	<b>A000B7D</b>	<b>1,869</b>	<b>28,131</b>

Key: TBA = To be assigned, N/A = Not Applicable

<b>Accessories</b>			
	P/N	S/N	TSO
<b>PROPELLER GOVERNOR</b>	<b>8210-034L</b>	<b>2250705</b>	<b>157.5</b>
<b>FUEL CONTROL UNIT</b>	<b>8061-328</b>	<b>2136229</b>	<b>0.0</b>
<b>FUEL PUMP</b>	<b>399701-5</b>	<b>0696</b>	<b>1,457.4</b>
<b>OIL/FUEL HEATER</b>	<b>3057249-01</b>	<b>7250</b>	<b>UNKNOWN</b>
<b>COMP. BLEED VALVE</b>	<b>3117010-01</b>	<b>3N304</b>	<b>1,457.4</b>

Key: TBA = To be assigned, N/A = Not Applicable

Comments: All engines ship FOB ATS dock.